

Bulletin Number 10/01/99 99-1

SERVICE

SERVICE BULLETIN

SUBJECT:

C31577 Deck Leveling Rod

0

MODELS

PARTS INVOLVED:

INFORMATION:

RM44 AND RM48 MOWER DECKS

C47195

Leveling Rod Kit

List Price \$22.75

The C31577 leveling rod is no longer available and has been replaced by C47195 leveling rod kit. This kit includes the C47007 leveling rod, C47010 bracket, (2) 7/16 -14, grade 5 whiz lock nuts, 3/8 x 1"clevis pin and cotter pin.



PROCEDURE: CORRECTIVE Please note the above sub and price information in the Parts Price and

Substitution Book 99-3 for future reference.

casecoltingersoll.con



DEALER	SERVICE	PARTS	MECHANICS	REFERENCE
PRINCIPAL	MANAGER	MANAGER		FILE
PAL	MANAGER	MANAGER		FILE

	99-2	
	Bulletin Number	
	10/01/99	
Name of Street, or other Designation of Street, or other Desig	Date	nega.



SERVICE BULLETIN

SUBJECT:

RM SERIES DECK SHELL REPLACEMENT

MODELS INVOLVED: RM38 deck shells prior to PIN # 010308055 Part #C31507 RM44 deck shells prior to PIN # 010307024

Part #C31526

RM48 deck shells prior to PIN # 010307021

Part #C31535

PARTS INFORMATION: The older style deck shells with the part numbers above are no longer available. In order to properly substitute a direct shell replacement, first determine if the customer has ever had a newer style suspension kit, C44689, installed for his mower deck.

CORRECTIVE

PROCEDURE:

Determine if the suspension kit has been installed:

If the C44689 kit has been installed:

The bellcrank leveling rod is welded onto the nose of the deck. The leveling bellcrank is free to rotate on the rod as shown in figure 1.

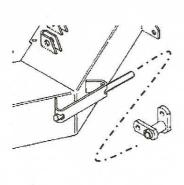


Figure 1

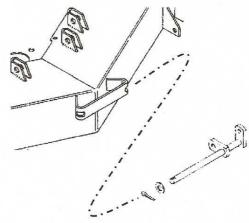


Figure 2

If the C44689 kit has not been installed:

The bellcrank leveling rod will be slid into the nose of the deck and is secured with a cotter pin and washer. The rod will be free to rotate in the nose of the deck as shown in figure 2.

Over...

Continued:

99-2 Bulletin Number 8/5/99 Date

For deck shell replacement, order the correct part number indicated below:

Mower Deck Model	Kit Previously Installed	Kit Not Installed
RM48	C44661 Shell, New Style	C44876 Kit
RM44	C44659 Shell, New Style	C44875 Kit
RM38	C44657 Shell, New Style	C44874 Kit

NOTE: This bulletin is for informational purposes only. This is not a mandatory service change.